

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

CHILD SEATS:

None during March 2016.

EQUIPMENT:

American Grease Stick Company (AGS) is recalling certain bottles of Carquest DOT5 Silicone Brake Fluid manufactured January 1, 2014, to September 15, 2015. The affected bottles may not clearly show the minimum wet equilibrium reflux boiling point (ERP) rating, and may not contain the words "Motor Vehicle" on the label where the bottle identifies the contents as DOT Brake Fluid. As such, these bottles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 116, "Motor Vehicle Brake Fluids." If a customer were confused by the label, they might use the wrong brake fluid, which could result in decreased braking performance and thereby increase the risk of a crash. AGS will notify purchasers and the bottles will be returned and relabeled with the correct label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact AGS customer service at 1-800-253-0403.

16E-016

Bergstrom Inc. (Bergstrom) is recalling certain ParkSmart HVAC Auxiliary units manufactured for Freightliner Cascadia trucks, specifically models A22-69027-004, A22-69027-005, A22-72122-001, A22-72122-002, and BSM 1000627018. High electrical resistance from inadequate contact between the electrical connector on the compressor end of the harness and the electrical pins on the top of the compressor may result in excessive heat. The overheated connection can increase the risk of a fire. Bergstrom will notify owners, and dealers will replace the connector caps. Additionally, dealers will replace the harnesses if there is evidence of heat discoloration. These repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Bergstrom customer service at 1-815-874-7821.

16E-017

ZF Group North America Operations (ZF) is recalling certain Control Arms model numbers 0501 218 145, and 0501 211 327 manufactured June 23, 2015, to February 2, 2016. The hot crimping that connects the tube ends to the control arm joint housing shafts may crack, causing the tube to separate from the shaft. Should the tube crack and separate from the shaft of the vehicle, loss of vehicle control is possible, increasing the risk of a crash. ZF will notify dealers and exchange all affected parts with new parts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ZF customer service at 1-734-416-6200.

16E-018

Orscheln Products L.L.C. (Orscheln) is recalling certain Cable Connector Clips Part No. 15867200, 15867201, 15867202, 15867204, 15880700, 15880701, 15880702, 15883400, 15884000, 23034304, 23034305, 23034306, 23035801, 23035802, 23035803, 23037200, 23037201, 23037202, 1586704-P, 15880700-P, and 82100600 manufactured January 19, 2015, to September 30, 2015. The metal connecting clip that connects the hand operated parking brake actuator may fail. Unintentional release of the parking brake can cause the vehicle to roll, increasing the risk of injury or a crash. Orscheln will notify its customers and will replace the parking brake cable connector clip with properly heat treated cable clips, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Orscheln customer service at 1-

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

660-269-4900.

16E-019

Ricon Corporation (Ricon) is recalling certain model S2005, S2010, S5005, S5010, S5505, and S5510 wheelchair lifts manufactured August 26, 2014, to July 1, 2015. The platform side plate of the affected wheelchair lifts may crack. Additionally, the lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the platform side plates crack or the platform mounting fails from out-of-position bearings, the lift platform can separate from the lift and come to rest against the vehicle's lift door. When the vehicle's doors are opened, the platform may fall onto the lift operator, increasing their risk of injury. Ricon will notify the purchasers of the lifts, and their dealers will inspect the side plates for damage and for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin April 11, 2016. Owners may contact Ricon customer service at 1-800-322-2884.

16E-020

Battery-Biz Inc. (Battery-Biz) is recalling certain CynTur CTJSLI Lithium Ion Jumpstarters manufactured December 24, 2014, to November 1, 2015. Due to faulty design of the cable assembly, the jumpstarter may overheat and catch fire. Over-cranking will cause the cable to melt and the pack to overheat and catch fire. Battery-Biz began notifying owners, and retailers on February 26, 2016. The manufacturer will provide a free replacement cable, with new safety features. The replacement cables will begin shipping after March 31, 2016. Owners may contact CynTur customer service at 1-800-780-6552 or through the CynTur website at www.cyntur.com/recall.

16E-021

International Specialty Services, Inc. (ISS) is recalling certain Evercraft jack stands, model 776-2000, manufactured June 1, 2015 to March 7, 2016 and sold by NAPA Auto Parts stores. During production, the welds may not have been properly located and, as a result, the jack stands may collapse during use. If the jack stand collapses, the vehicle could fall, increasing the risk of injury to the individual working underneath it or people around it. ISS is working to identify customers who have purchased the product. NAPA stores will refund the full purchase price. The recall is expected to begin on March 25, 2016. Owners may contact ISS at 1-864-660-8307.

16E-022

Honda (American Honda Motor Co.) is recalling certain accessory rear trunk bases Part number's 08L71-K35-J00, 08L70-KZY-910, and 81200-KWN-780. The accessory rear trunk base may not fully engage to the removable trunk rear locking hook, allowing the trunk to inadvertently detach. If the trunk base does not fully engage with the rear locking hook, causing the trunk to detach during operation, increasing the risk of a crash. Honda will notify owners to discontinue use of the rear trunk, and dealers will replace the trunk base with a newly designed trunk base when parts become available, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-800-999-1009. Honda's number for this recall is JY8.

16E-023

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

Strategic Sports, Ltd. (Strategic Sports) is recalling certain Leather Up XElement helmets, part numbers ST-559-12GB and 11FB, in sizes L, XL, and XXL, manufactured June 11, 2013, to August 30, 2013. The affected helmets may not adequately protect a user in the event of a crash. As such, these helmets fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 218, "Motorcycle Helmets." An individual's head may not be fully protected when wearing this helmet, increasing the risk of injury in the event of a crash. Strategic Sports will notify the owners and provide them with a full refund, free of charge. The recall is expected to begin April 25, 2016. Owners may contact Strategic Sports customer service at 1-619-861-8110.

16E-024

TIRES:

Cooper Tire & Rubber Co. (Cooper) is recalling certain Roadmaster RM234 tires, size 295/75R22.5, manufactured August 6, 2015, to September 5, 2015 (weeks 3115-3515). The affected tires may have a pin-sized hole in the sidewall that can result in a loss of air. A loss of tire air pressure can cause sudden tire failure, increasing the risk of a crash. Cooper will notify owners, and dealers will replace the tires including the mounting and balancing, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Cooper customer service at 1-800-854-6288. Cooper's number for this recall is 4Y.

16T-003

VEHICLES:

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2014-2016 Freightliner Custom Chassis XCP chassis manufactured from April 26, 2013, through December 15, 2014. The power steering fluid temperature may exceed the hose material ratings on some rear engine chassis built with certain 18,000lb and 20,000lb-load capacity front axles used in motor home applications. This can cause the hose to fail, resulting in a sudden loss of power steering fluid and power assist. Loss of power steering assist would result in increased difficulty to steer the vehicle in either direction at low speeds, increasing the risk of a crash. DTNA will notify owners, and dealers will replace the power steering hose with a hose that has a higher temperature rating, free of charge. The recall is expected to begin on April 26, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's recall number for this campaign is FL-702.

16V-121

Maserati North America, Inc. (Maserati) is recalling certain model year 2014-2016 Quattroporte and Ghibli vehicles manufactured February 1, 2013, to November 30, 2015. In the affected vehicles, the driver-side floor mat anchor may break allowing the floor mat to move and get trapped between the accelerator pedal and the vehicle carpet. If the floor mat moves and becomes trapped between the accelerator and the vehicle carpet, it may result in very high vehicle speeds, which could cause a crash, serious injury or death. Maserati will notify owners, and dealers will replace the driver-side floor mat and possibly the accelerator pedal cover, free of charge. The recall is expected to begin April 29, 2016. Owners may contact Maserati customer service at 1-201-816-2600. Maserati's number for this recall is 301. Note: These vehicles are equipped with a brake

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

override system. In the event a pedal is trapped, pushing on the brake pedal will brake the vehicle and enable the driver to slow and stop and turn off the vehicle.

16V-122

Pierce Manufacturing (Pierce) is recalling certain model year 2016 Arrow-XT, Dash, Enforcer, Impel, Quantum, Saber, and Velocity fire and emergency vehicles manufactured October 13, 2015, to February 9, 2016. The fastener cap over the bearing on the universal joint of the drive shaft may have been improperly tightened. If the cap was not properly tightened, the cap may detach from the vehicle and become a road hazard. Additionally, the universal joint may separate and the vehicle may not be able to be driven, increasing the risk of a crash. Pierce will notify owners, and dealers will check and correct the tightness of all bolts for the universal joint caps, as needed, free of charge. The recall began on March 25, 2016. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B270.

16V-123

KTM North America, Inc. (KTM) is recalling certain model year 2013-2014 Husqvarna TR650 Terra and TR650 Strada motorcycles manufactured January 1, 2012, to December 31, 2013. The affected motorcycles may unexpectedly stall. A stall increases the risk of a crash. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact KTM customer service at 1-440-985-3553.

16V-124

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Colorado vehicles manufactured January 19, 2016, to February 2, 2016, Chevrolet Malibu vehicles manufactured January 9, 2016, to January 26, 2016, and 2016 GMC Canyon vehicles manufactured January 21, 2016, to February 4, 2016. The driver frontal air bag may improperly inflate during second-stage deployment in the event of a high speed crash. An improperly inflated air bag increases the risk of injury. GM will notify owners, and dealers will replace the driver side frontal air bag module, free of charge. The recall is expected to begin in April 2016. Owners may contact Chevrolet customer service at 1-800-222-1020, and GMC customer service at 1-800-462-8782. GM's number for this recall is 28030.

16V-125

Forest River, Inc. (Forest River) is recalling certain model year 2016-2017 Dynamax Rev recreational vehicles manufactured from April 1, 2015, through February 15, 2016, and 2016-2017 Coachman Orion recreational vehicles manufactured from May 18, 2015, through December 10, 2015. These vehicles, built on RAM ProMaster chassis, have an ignition switch that may have an intermittent loss of electrical contact. An intermittent loss of contact can result in a vehicle stall and/or a partial or complete loss of air bags, anti-lock brakes, electronic stability control and/or instrument panel cluster. Loss of functionality with any of these safety systems can increase the risk of crash and/or increase the risk of injury in the event of a crash. Forest River will notify owners, and Fiat Chrysler Automobiles (FCA) dealers will replace the ignition switch contact holder block, free of charge. The recall is expected to begin on April 29, 2016. Owners may call the FCA Recall Assistance Center at 1-800-853-1403 or contact Forest River customer service at 1-574-262-3474. Forest River's number for this recall is 51-022242016-0138.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

16V-126

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2008-2010 Lexus SC vehicles manufactured August 3, 2007, to July 30, 2010, 2008 Toyota Corolla vehicles manufactured May 25, 2007, to December 21, 2007, 2008 Toyota Corolla Matrix vehicles manufactured June 1, 2007, to December 18, 2007, and 2008 Pontiac Vibe vehicles manufactured May 25, 2007, to December 21, 2007. This is to address a safety defect in the passenger side frontal air bag inflator which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag. This recall addresses both the passenger side frontal air bags that were originally installed in the vehicles, as well as replacement air bags that may have been installed as replacement service parts. A replacement air bag may have been installed, as one example, if a vehicle had been in a crash necessitating the replacement of the passenger side frontal air bag. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. The recall began on March 25, 2016 for Toyota and Lexus vehicle owners. A date has not yet been provided for Pontiac Vibe owners to be notified by GM. The respective dealers will either replace the front passenger air bag inflator or the entire front passenger air bag assembly depending on the model. Owners may contact Toyota customer service at 1-800-331-4331, or Pontiac customer service at 1-800-762-2737. This recall expands recall 15V-285.

16V-127

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2008-2010 Lexus SC vehicles manufactured August 3, 2007, to July 30, 2010, 2008 Toyota Corolla vehicles manufactured June 1, 2007, to December 21, 2007, 2008 Toyota Corolla Matrix vehicles manufactured June 1, 2007, to December 18, 2007, and 2008 Pontiac Vibe vehicles manufactured May 25, 2007, to December 21, 2007 that were originally sold, or ever registered, in Florida, Puerto Rico, Hawaii, the U.S. Virgin Islands, Guam, Saipan, American Samoa, Georgia, Alabama, Louisiana, Mississippi and Texas. The affected vehicles have a passenger side frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture upon its deployment. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking the vehicle occupants potentially resulting in serious injury or death. The recall began on March 25, 2016 for Toyota and Lexus vehicle owners. A date has not yet been provided for Pontiac Vibe owners to be notified by GM. The respective dealers will either replace the front passenger air bag inflator or the entire front passenger air bag assembly depending on the model. Owners may contact Toyota customer service at 1-800-331-4331, or Pontiac customer service at 1-800-762-2737. This recall expands recall 15V-286.

16V-128

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2015-2016 Predator emergency vehicles manufactured from May 19, 2014, through August 15, 2015, equipped with K gearboxes manufactured by Hale Products, Inc. The affected gearboxes may shift out of gear from "road" to "neutral" while the vehicle is in transit. An unexpected shift in the transmission could result in a vehicle crash. KME will notify owners. The existing gearbox will be inspected and, where necessary, a replacement gearbox will be ordered and installed. Repairs will be performed free of charge. The recall began on April 8, 2016. Owners may contact KME customer service at 1-800-235-3926.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

16V-129

Strick Trailers, LLC (Strick) is recalling certain model year 2001, 2003, 2005, and 2008-2012 Single axle van trailers equipped with rear impact guards using gussets 50185 and 50186. These rear impact guard gussets increase the chances of injury in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 223, "Rear Impact Guards." If the rear impact guards do not meet the safety standards, it can increase the risk of injury in the event of a crash. Strick will notify owners, and service centers will install reinforcements free of charge. The recall began on April 15, 2016. Owners may contact Strick customer service at 1-704-436-2590.

16V-130

Prevost Cars, Inc. (Prevost) is recalling certain model year 2015-2016 X3-45 vehicles manufactured from October 1, 2014, through February 12, 2016, equipped with American Seating sliding passenger seats. The sliding seats on the affected vehicles may experience cracks between the seat frame and the support pedestal. A crack in the seat attachment could compromise the structural integrity of the seat, increasing the risk of passenger injury in the event of a crash. Prevost will notify owners, and dealers will replace the sliding seats, free of charge. The recall is expected to begin on, or about, April 20, 2016. Owners may contact Prevost customer service at 1-418-883-3391. Prevost's number for this recall is SR16-305.

16V-131

Universal Trailer Cargo Group, Inc. (Universal Trailer) is recalling certain model year 2007-2010 Haulmark Motorcoach vehicles manufactured April 1, 2007, to June 30, 2010. The bolt that attaches the fan gear assembly to the steps may fracture allowing the fan gear to disengage from the steps. As a result, the steps may not remain in the expected position and may become unstable. Unstable entry and exit steps increase the risk of injury. Universal Trailer will notify owners, and dealers will install a retainer bracket on the double step assemblies and the Coachstep Linkage Assembly will be replaced and a retainer bracket will be installed on the trip step assemblies. The recall is expected to begin May 9, 2016. Owners may contact Universal Trailer customer service at 1-574-264-9661.

16V-132

Prevost Cars, Inc. (Prevost) is recalling certain model year 2011-2016 H3-41, H3-45, H3-VIP and X3-45 Coach vehicles, 2012-2016 X3-VIP vehicles and 2011-2013 XL2 Entertainer vehicles. The coolant line on the affected vehicles may be missing a positioning clip, allowing the coolant line to rub against the braided fuel hose at one of the injectors. Contact between the fuel line and the coolant line may cause a fuel leak and result in fuel spraying onto hot exhaust components increasing the risk of an engine compartment fire. Prevost will notify owners, and dealers will inspect the fuel line for abrasion, replacing it as necessary. The fuel and coolant lines will be properly secured. These repairs will be performed free of charge. The recall is expected to begin April 20, 2016. Owners may contact Prevost customer service at 1-418-883-3391. Prevost's number for this recall is SR16-18.

16V-133

Spartan Motors USA (Spartan) is recalling certain model year 2016-2017 Specialty Vehicle school bus chassis

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

manufactured from March 19, 2015, through November 9, 2015. The metal connecting clip that connects the hand operated parking brake actuator cable to the intermediate parking brake cable may fail. If the parking brake cable connection fails, the vehicle may unexpectedly roll, increasing the risk of injury or a crash. Spartan will notify owners, and dealers will install new clips, free of charge. The parts are currently not available and all owners are advised to chock their wheels until the parts become available. The recall began on March 25, 2016. Owners may contact Spartan customer service at 1-800-543-4277. Spartan's number for this recall is 16005.

16V-134

Nova Bus (Nova) is recalling certain model year 2014-2016 LFS and LFS Artic vehicles manufactured from January 1, 2014, through February 15, 2016. On the affected vehicles, the pin on the wiper idler arm may strip causing the windshield wipers to become inoperative. If the windshield wipers become inoperative, visibility will be decreased, increasing the risk of a crash. Nova will notify owners, and dealers will replace the wiper idler arm, free of charge. The recall is expected to begin on April 20, 2016. Owners may contact Nova customer service at 1-800-350-6682. Nova's number for this recall is CR3601.

16V-135

Hardkore Karts LLC (Hardkore Karts) is recalling certain model year 2009-2013 Club Car Precedent golf carts equipped with the street package, manufactured July 1, 2013, to November 1, 2016. These vehicles do not have a vehicle identification number (VIN), certification label or DOT compliant windshield. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." In the event of a crash, a non-compliant windshield may have an increased risk of occupant injury compared to a DOT-compliant, safety-glass windshield. Hardkore Karts will notify owners, and provide a VIN, the correct certification label and install the correct windshield, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hardkore Karts customer service at 1-877-796-5501.

16V-136

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013-2015 Jaguar XF vehicles manufactured May 16, 2012, to June 15, 2015 and equipped with 2.0L GTDi engines. The retaining bolt for the Front End Auxiliary Drive (FEAD) idler pulley on the engine may fail resulting in a loss of power steering assist. A loss of power steering assist may increase the risk of a crash. Jaguar will notify owners, and dealers will replace the FEAD pulley assembly, free of charge. The recall is expected to begin May 2, 2016. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J061.

16V-137

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015-2016 e-Golf vehicles manufactured May 21, 2014, to March 1, 2016. Oversensitive diagnostics for the high-voltage battery management system falsely detect an electrical surge and cause the vehicle to stall unexpectedly. If the vehicle were to stall unexpectedly, it can increase the risk of a crash. Volkswagen will notify owners, and dealers will update battery management software, free of charge. The recall began March 15, 2016. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagens number for this recall is 93B4.

16V-138

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

Thor Motor Coach (TMC) is recalling certain model year 2014-2016 Hurricane and Windsport motor homes manufactured January 30, 2013, to March 6, 2015. In the affected motor homes, the vehicle exhaust is located near a storage compartment where heat may build-up, causing the compartment to melt. Heat build-up in the vehicle storage compartment increases the risk of fire. TMC will notify owners, and dealers will install a heat shield to prevent heat build-up in the storage compartment. The recall will begin in April 2016. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000112.

16V-139

Spartan Motors USA (Spartan) is recalling certain model year 2014-2015 Gladiator and MetroStar emergency vehicles manufactured from November 18, 2014, through July 9, 2015. Under certain conditions, the fire-suppression-agent tank level pressure sensor may register an incorrect reading. This may result in the reading to indicate more agent (typically water or fire fighting foam) left in the tank than actually is. If there is an incorrect reading of agent in the tank, it can increase the risk of injury to the fire fighter if the tank unexpectedly runs out of agent. Spartan will notify owners, and dealers will recalibrate the tank level system or supply a new sensor, free of charge. The recall began on March 30, 2016. Owners may contact Spartan customer service at 1-800-543-5008. Spartan's number for this recall is 16003.

16V-140

Navistar, Inc. (Navistar) is recalling certain model year 2016 International 1300 trucks manufactured February 26, 2015, to May 12, 2015, 2016-2017 International DuraStar trucks manufactured January 28, 2015, to February 4, 2016, International TerraStar trucks manufactured January 28, 2015, to February 1, 2016, and 2016 IC AC transit buses manufactured January 28, 2015, to February 2, 2015. The metal connecting clip that connects the hand operated parking brake actuator cable to the intermediate parking brake cable may fail. If the parking brake cable connection fails, the vehicle may unexpectedly roll, increasing the risk of injury or a crash. Navistar will notify owners, and dealers will replace the hand parking brake cable connector clips, free of charge. The recall is expected to begin May 7, 2016. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 16504.

16V-141

Setra of North America (Setra) is recalling certain model year 2005-2009 S417 coaches manufactured March 1, 2005, to February 28, 2009, that had service part lower control arm(s) installed. The hot crimping that connects the tube ends to the control arm joint housing shafts may crack, causing the tube to separate from the shaft. Should the tube crack and separate from the shaft of the vehicle, loss of vehicle control is possible, increasing the risk of a crash. MCI, the sales agent for these vehicles, notified owners verbally, and dealers will replace the lower control arms, free of charge. The recall began on March 28, 2016. Owners may contact Setra customer service at 1-416-624-3558. Setra's number for this recall is 33.10U10124B.

16V-142

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2015-2016 Freightliner Cascadia trucks manufactured from March 24, 2014, through November 9, 2015. The affected vehicles are equipped with Bergstrom Parksmart HVAC auxiliary units. On these units, there may be inadequate contact between the electrical connector on the compressor and electrical pins causing a high electrical resistance resulting in

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

excessive heat. The overheated connection can increase the risk of a fire. DTNA will notify owners, and dealers will replace the connector caps. Additionally, dealers will replace the harnesses if there is evidence of heat discoloration. These repairs will be performed free of charge. The recall is expected to begin on May 7, 2016. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's recall number for this campaign is FL-703.

16V-143

Van Hool N.V. (Van Hool) is recalling certain model year 2012 A300L, 2011 C2045, 2011-2013 T2145, 2012-2015 TD925, 2016 TDX25, and 2014-2015 TX45 motor coaches equipped with certain Recaro Ergo-M Commercial Bus Driver Seats. The affected seats have J-Brackets that may be missing welds which could allow the seat belt anchorage assembly to separate from the J-Bracket. If the seatbelt anchorage assembly separates from the J-Bracket, the bus driver may not be properly restrained in the event of a crash, increasing their risk of injury. Van Hool will notify owners, and dealers for the manufacturer of the seat will inspect the seats to determine if welds are missing. Any J-Bracket that is missing welds will be removed and replaced, free of charge. Van Hool's recall number for this campaign is P814-SB1354.

16V-144

Hyundai Motor America (Hyundai) is recalling certain model year 2016-2017 Santa Fe vehicles manufactured September 1, 2015 to February 12, 2016. In the affected vehicles, the wires in the front seat belt buckle harnesses may be damaged by the seat's height adjuster mechanism, resulting in a failure to provide an audible warning when front seat occupants do not fasten their seat belts. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." Without a warning to remind the front seat occupants that their seat belts are not buckled, they may forget to buckle their seat belt, increasing their risk of injury in the event of a crash. Hyundai will notify owners, and dealers will inspect and reroute the wires in the front seat belt buckle harnesses to their proper locations, as necessary, free of charge. The recall is expected to begin May 6, 2016. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 141.

16V-145

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2016 GLC 300 vehicles manufactured June 16, 2015, to November 3, 2015, and 2016 GLC 300 4Matic vehicles manufactured July 16, 2015, to November 3, 2015. The steering columns in the affected vehicles may have the wiring harness for the switch module incorrectly routed. As a result, the harness may chafe and the air bag may unexpectedly deploy or the engine may stall. An unexpected air bag deployment or engine stall increases the risk of a crash. MBUSA will notify owners, and dealers will inspect the wiring harnesses, properly rerouting them as necessary. Any damaged harnesses will be replaced. These repairs will be performed free of charge. The recall is expected to begin in April 2016. Owners may contact MBUSA customer service at 1-800-367-6372.

16V-146

Hyundai Motor America (Hyundai) is recalling certain model year 2016 Hyundai Tucson vehicles manufactured May 26, 2015 to January 15, 2016 and equipped with an accessory trailer hitch harness either included with

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

accessory trailer hitch or sold as a service part. In the affected vehicles, when the vehicle engine is running and the brake lights are illuminated, if the turn signal is activated the brake lights will either turn off or remain continuously illuminated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards No. 108, "Lamps, Reflective Devices, and Assoc. Equipment." Failure to illuminate the brake lights during braking or indicate driver intent to other vehicles could increase the risk of a crash. Hyundai will notify owners, and dealers will replace the tow hitch harness, free of charge. The recall is expected to begin May 6, 2016. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 142.

16V-147

Pierce Manufacturing (Pierce) is recalling certain model year 2014-2016 Enforcer and Saber emergency vehicles manufactured from March 3, 2014, through February 3, 2016. The clamps on the heater hose may have been improperly installed allowing engine coolant to leak into the passenger compartment. If coolant leaks into the passenger compartment, it may contact electrical components causing a shorting of circuits and a loss of function of features controlled by those circuits, including loss of power to vehicle which may result in a stall and increase the risk of a crash. The hot coolant may also contact occupants and possibly cause burn injuries. Pierce will notify owners, and dealers will inspect the hose clamp installation. Any improperly installed clamps will be corrected free of charge. The recall is expected to begin in April 2016. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B269.

16V-148

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Nissan Rogue vehicles manufactured July 25, 2013, to December 21, 2013, and February 1, 2014, to June 7, 2014. Improper nickel plating of components within the fuel pump may result in the fuel pump failing. If the fuel pump fails, the vehicle may stall without warning, increasing the risk of a crash. Nissan will notify owners, and dealers will replace the fuel pump, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

16V-149

Forest River, Inc. (Forest River) is recalling certain model year 2006-2012 Amera-Lite cargo trailers manufactured November 2, 2005, to July 21, 2011; 2007-2013 Cargo Mate cargo trailers manufactured December 1, 2006, to February 27, 2013; 2005-2016 Continental Cargo cargo trailers manufactured January 27, 2005, to November 11, 2015; and 2007-2012 US Cargo cargo trailers manufactured January 30, 2007, to July 12, 2011. The tire pressure specification for the 5.30" x 12" Load Range C Tire is listed as 50 PSI instead of the correct tire pressure specification of 80 PSI. As a result, the subject vehicles have incorrectly stated Gross Axle Weight Rating (GAWR) and Gross Vehicle Weight Rating (GVWR) on the Federal Placard. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." Using the trailers to the loading specifications on the label while the tires are underinflated may result in sudden tire failure, increasing the risk of a crash. Forest River will notify owners and will provide Federal placard stickers with the correct PSI, GAWR, and GVWR, free of charge. The recall began on April 8, 2016. Owners may contact Forest River customer service at 1-574-266-7539. Forest River's number for this campaign is 51-02292016-0141.

16V-150

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

General Motors LLC (GM) is recalling certain 2016 Malibu vehicles manufactured February 16, 2016, to March 5, 2016. The two weld studs that mount the front and rear side impact air bags may fracture and separate from the air bag during deployment. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) No. 214, "Side Impact Protection." Fractured weld studs may allow the side air bag to move out of position during deployment, increasing the risk of injury. GM will notify owners, and dealers will replace the side air bag modules, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 31820.

16V-151

Stallion Bus and Transit Corp. (Stallion Bus) is recalling certain model year 2013 900 series transit buses manufactured from March 1, 2013, through October 31, 2013. The 12 volt to 24 volt power converter on the wiper system may shut off when the wiper speed is changed resulting in a loss of wiper function. Visibility will be reduced should the wiper assembly stop working during operation, increasing the risk of a vehicle crash. All of the affected buses were repaired in April 2014. Therefore, an owner notification letter will not be issued for this recall campaign. Owners may contact Stallion Bus customer service at 1-631-270-3800.

16V-152

Lakota Corporation (Lakota) is recalling certain model year 2016 Bighorn and Charger recreational vehicles manufactured from March 5, 2015, through March 20, 2015. In the affected vehicles, the screws that attach the expanding room to the sliding mechanism cable may fail allowing the room to extend unintentionally while the vehicle is in motion. If the room extends while vehicle is in motion, there is an increased risk of a crash. Lakota will notify owners, and dealers will replace the bolts, free of charge. The recall began on April 8, 2016. Owners may contact Lakota customer service at 1-574-848-1636.

16V-153

Terex South Dakota, Inc. (Terex) is recalling certain model year 2015-2016 C5000, C6000, General 80, RMX, TM100, and TM125 aerial devices, and digger derrick lifts installed on trucks manufactured August 4, 2015, to February 16, 2016. The suspension circuit can inflate the suspension air bags on the affected vehicles if the Master/PTO switch or ignition is turned off in the cab while the boom is in the raised position. This can cause the frame to rise, lifting the outriggers from the ground. If the outrigger lifts off the ground, causing instability of the truck, it can increase the risk of injury to the operator. Terex will notify owners, and dealers will install a second outrigger enable relay, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-982-8975. Terex's number for this recall is SN636.

16V-154

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2015 Winnebago Adventurer vehicles manufactured January 16, 2016, to March 8, 2016, and 2015-2016 Itasca Suncruiser vehicles manufactured January 6, 2016, to March 8, 2016. In the affected vehicles, the bolts that attach the hitch to the frame were not properly torqued. Improper torquing of the hitch bolts could cause the hitch to detach, increasing the risk of a crash. Winnebago will notify owners, and dealers will inspect and, where necessary, replace the hitch attachment bolts free of charge. Owners may contact Winnebago customer service at 1-641-585-3535. Winnebago's

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

number for this recall is 140.

16V-155

Mack Trucks, Inc. (Mack) is recalling certain model year 2016-2017 Titan vehicles manufactured from February 25, 2015, through February 12, 2016. The bolt connecting the upper steering shaft to the lower steering shaft may not properly secure the upper steering shaft, which can lead to separation of the steering shaft. Separation of the steering shaft will result in complete loss of steering which may lead to a vehicle crash. Mack strongly recommends that the affected vehicles not be driven until the interim remedy is applied. An interim notice was sent to Mack owners on March 21, 2016, and an interim repair is available now. A second notice will be sent when the final remedy is available. Both remedies will be free of charge. Owners may contact Mack customer service at 1-877-800-4945 opt #1. Mack's number for this recall is SC0401.

16V-156

Rosenbauer Motors (Rosenbauer) is recalling certain 2012-2015 Commander vehicles manufactured January 1, 2012, to May 1, 2015. The brake pedal piston on the affected vehicles may corrode, causing the brake pedal to stick or be difficult to activate. If the piston corrodes, the brakes may be difficult to activate or the brakes may drag and overheat. Either scenario can increase the risk of a crash. Rosenbauer will notify owners, and dealers will install a solid spacer plate, pedal base, piston and piston seal, sealing this assembly to prevent contamination, free of charge. The recall is expected to begin in April 2016. Owners may contact Rosenbauer customer service at 1-651-462-1000.

16V-157

Jayco, Inc. (Jayco) is recalling certain model year 2016 White Hawk travel trailers, model 25BHS, manufactured on March 3, 2016. The affected trailers were incorrectly built on axles rated for 3000 lbs., when they should have been built with axles that have a capacity of 3500 lbs. If the trailer is loaded to the capacity listed on the label, trailer handling may be affected, increasing the risk of a crash. All of the affected trailers have been quarantined at Jayco dealers prior to their sale and thus no owner notification letters will be sent. Dealers will install the correct axles, free of charge. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901291.

16V-158

Winnebago Towable (Winnebago) is recalling certain 2016 Instinct trailers manufactured January 12, 2016, to February 29, 2016. The affected trailers may have an inadvertent "I" stamped as the fifth character in the VIN number. No direct safety risk exists but an accurate VIN is required to verify trailer applicability for any future safety recalls. Winnebago will notify owners, and dealers will install a new VIN plate over the incorrect VIN plate, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-574-825-5250.

16V-159

General Motors LLC (GM) is recalling certain model year 2014-2016 Caprice Police Pursuit Vehicles manufactured May 15, 2013, to March 3, 2016. Corrosion of the connector between the electric power steering module and the torque sensor connector may cause a loss of electric power steering assist. A greater

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

steering effort would be needed to control the vehicle if power steering is lost, increasing the risk of a crash. GM will notify owners, and dealers will replace the steering gear assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 22010.

16V-160

Winnebago Towable (Winnebago) is recalling certain model year 2016 Winnie Drop recreational trailers manufactured September 10, 2015, to March 8, 2016. The refrigerator compartment may not be completely sealed and thus may allow carbon monoxide to enter the main cabin. If carbon monoxide were to enter the main cabin, it can increase the risk of carbon monoxide poisoning, or possible death. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-574-825-5250.

16V-161

Subaru of America, Inc. (Subaru) is recalling certain model year 2015-2016 WRX vehicles manufactured April 10, 2015, to October 21, 2015, and Forester 2.0XT vehicles manufactured April 10, 2015, to October 20, 2015. The turbocharger air intake duct may crack and possibly result in an engine stall. An engine stall increases the risk of a crash. Subaru will notify owners, and dealers will inspect the turbocharger air intake duct, and replace it as necessary, free of charge, depending on the lot number found on the duct. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is WTA-62.

16V-162

Triumph Motorcycles America, LTD. (Triumph) is recalling certain model year 2016 Street Twin motorcycles manufactured September 7, 2015, to November 21, 2015. The wiring within the sub-harness that carries electric from the main harness to the fuel pump may become damaged and exposed to fuel inside the fuel tank. If fuel contacts the exposed electrical wire it could increase the risk of a fire. Triumph will notify owners, and dealers will inspect the harness and if it has specific batch numbers the harness will be replaced, free of charge. The recall began March 25, 2016. Owners may contact Triumph customer service at 678-854-2010.

16V-163

Forest River, Inc. (Forest River) is recalling certain model year 2016 Cherokee Grey Wolf recreational trailers manufactured from March 23, 2015, through March 9, 2016. The Federal Placard incorrectly indicates the tire and rim size as ST205/75R15/C Tire(s) with 15X5.0JJ rims. However, the trailer is equipped with ST205/75R14/C Tire(s) with 14X5.5JJ rims. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." Incorrect information on the Federal Placard may lead to the operator overloading the vehicle, increasing the risk of a tire blowout and the possibility of a crash. Forest River will notify owners and will send them a corrected Federal Placard, free of charge. The recall is expected to begin on, or about, May 16, 2016. Owners may contact Forest River customer service at 1-541-995-3447 extension 4013. Forest River's recall number for this campaign is 64-03112016-0147.

16V-164

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

Weiler, Inc. (Weiler) is recalling certain model year 2002-2016 B2, B3, B5, F1, F3, F5, M100, M200, and WT4000 trucks manufactured April 8, 2003, to March 21, 2016. These trucks may have been produced with LED marker lights that do not have reflectors built into the lenses, thus reducing the visibility of the truck. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Missing reflectors can reduce the visibility of the vehicle, increasing the risk of a crash. Weiler will notify owners will supply reflective decals to be installed, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Weiler customer service at 1-641-828-6622.

16V-165

Bugatti is recalling certain 2006-2010 Veyron vehicles manufactured March 10, 2006, to March 9, 2012, 2010-2012 Veyron Grand Sport vehicles manufactured September 29, 2009, to October 14, 2014, and 2011-2013 Veyron Super Sport vehicles manufactured February 18, 2011, to August 17, 2012. In the affected vehicles, the underbody aluminum reference plates used when lifting the vehicle may corrode and detach from the vehicle. If these jacking plates separate from the vehicle while driving, they may be a road hazard, potentially striking another vehicle, and increasing the risk of a crash. Bugatti will notify owners, and dealers will rivet and seal the underbody aluminum reference plates, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Bugatti at (805) 557-1050 .

16V-166

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Ram 1500 trucks manufactured January 22, 2015, to September 13, 2015. Contamination on the Electric Power Steering (EPS) control circuit board may cause a short and result in the loss of power steering assist. If the vehicle experiences a loss of power steering assist, extra steering effort will be required, especially at lower speeds, increasing the risk of a vehicle crash. Chrysler will notify owners, and dealers will replace the EPS unit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S19.

16V-167

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Jeep Grand Cherokee and Dodge Durango vehicles manufactured December 9, 2015, to January 14, 2016. In the affected vehicles, the left front brake caliper may crack due to being made from an incorrect material. A cracked brake caliper may lengthen the distance needed to stop the vehicle and increase the risk of a crash. Chrysler will notify owners, and dealers will inspect the front left brake caliper and depending on its casting date, replace it, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S16.

16V-168

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2011-2016 Cayenne vehicles manufactured April 28, 2010, to January 11, 2016. The brake pedal pivot pin may be missing a circlip, allowing the pivot pin to move and the brake pedal to dislodge. If the brake pedal dislodges, the driver may not be able to apply the brakes, increasing the risk of a crash. Porsche will notify owners, and dealers will inspect the brake

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

pedal assembly circlip, installing any missing circlips, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AG02.

16V-169

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2011-2016 Touareg vehicles. The brake pedal pivot pin may be missing a securing clip, allowing the pivot pin to move and the brake pedal to dislodge. If the brake pedal dislodges, the driver may not be able to apply the brakes, increasing the risk of a crash. Volkswagen will notify owners, and dealers will inspect the brake pedal assembly to verify the presence of the securing clip and install any missing securing clips, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 46G4.

16V-170

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2012-2014 Passat vehicles. The wire seals for the underbody assembly sensor may be improperly assembled that can allowing water to enter and corrode the electrical terminals, causing an electrical short. If there is an electrical short, it can cause the electrical connection to overheat, increasing the risk of a fire. Volkswagen will notify owners, and dealers will inspect the connector, and if necessary replace the connector, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 23T3.

16V-171

Blue Bird Body Company (Blue Bird) is recalling certain model year 2011-2017 All American school buses manufactured from August 20, 2010, through December 16, 2015. Buses with rear side emergency doors have seats over the wheelhouse area whose rear legs may detach from the floor in a crash, resulting in belted occupants traveling forward. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." If the seat does not allow the occupant to be properly restrained in the event of a crash, they would be at an increased risk of injury. Blue Bird will notify owners, and dealers will replace the rear leg assembly, free of charge. The recall is expected to begin on, or about, April 22, 2016. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's recall number for this campaign is R16YM-SB.

16V-172

BMW of North America, LLC (BMW) is recalling certain model year 2016 740Li, 750Li, and 750Lxi vehicles manufactured July 1, 2015, to December 11, 2015. The affected vehicles have an air bag control module that may randomly reset due to an electrical short circuit as a result of residual metallic particles from the manufacturing process. In the event of a crash while the air bag module is resetting, the air bags may not deploy, increasing the risk of occupant injury. BMW will notify owners, and dealers will replace the air bag control module, free of charge. The recall is expected to begin May 16, 2016. Owners may contact BMW customer service at 1-800-525-7417.

16V-173

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

Terex South Dakota, Inc. (Terex) is recalling certain model year 2007-2013 TLM37, TLM40, TLM41, and TLM50 aerial devices manufactured March 29, 2007, to January 31, 2013. The aerial devices have the pedestal attached to the lift turrets that may crack due to missing reinforcements. Cracks, if not repaired, may result in the failure of the aerial pedestal, increasing the risk of injury to the operator or those nearby. Terex will notify owners, and dealers will install reinforcement plates on the pedestal, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-982-8975. Terex's number for this recall is SN622.

16V-174

Forest River, Inc. (Forest River) is recalling certain model year 2013-2016 Puma recreational trailers, models T12RBC, T15UDC, T17QBC, and T18FBC, manufactured from January 1, 2013, through March 1, 2016. When the trailer hits a bump, the tire(s) may contact the floor or wheel well and result in tire damage. A damaged tire could deflate and cause a loss of vehicle control, increasing the risk of a crash. Forest River will notify owners, and dealers will install a lift kit to add additional clearance to the vehicles, free of charge. The recall is expected to begin on, or about, May 27, 2016. Owners may contact Forest River customer service at 1-574-642-0607. Forest River's number for this recall is 420-06092015-0050SA.

16V-175

Forest River, Inc. (Forest River) is recalling certain model year 2015-2017 Georgetown recreational vehicles, model GTA369XLF, manufactured from December 8, 2014, through March 22, 2016. A vented window was installed in the rear wall of the vehicle instead of a secondary egress window. Without a secondary egress window, occupants may be trapped in the event of an emergency, increasing the risk of injury or death. Forest River will notify owners, and dealers will remove the vented window and install an egress window, free of charge. The recall is expected to begin on, or about, May 27, 2016. Owners may contact Forest River customer service at 1-574-206-7600. Forest River's number for this recall is 15-03232016-0151.

16V-176

Terex South Dakota (Terex) is recalling certain model year 2011-2016 HR, HRX, TC, TCX, and SML aerial devices. The affected aerial devices may have inadequate welds at the boom tip leveling sprockets. A failure of these welds may result in the platform tilting unexpectedly. If the platform tilts unexpectedly, the user may fall, increasing their risk of injury. Terex will notify owners. The remedy plan has not been finalized. The manufacturer has not yet provided a notification schedule. Owners may contact Terex South Dakota at 1-800-982-8975. Terex's number for this recall is SN638.

16V-177

Honda (American Honda Motor Co.) is recalling certain model year 2004-2007 Accord vehicles manufactured October 1, 2003, to August 17, 2007. The affected vehicles may have been assembled with the incorrect front passenger air bag module. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 208, "Occupant Crash Protection." If the air bag module does not meet advanced air bag requirements, it can increase the risk of injury in the event of a crash. Honda will notify owners, and dealers will inspect and replace the air bag module if necessary, free of charge. The recall is expected to begin May 5, 2016. Owners may contact Honda customer service at 1-800-999-1009. Honda's number for

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016

Published April 19, 2016

this recall is JZ3.

16V-178

Forest River, Inc. (Forest River) is recalling certain model year 2008-2016 Puma recreational trailers and toy haulers, models PT20RDC, PT21FBC, PT22RBC, PT26RLC, PT26FBSC, PT21TUC, PT25FBC, PT22RB, PTH21TFU, PTH24THS, PTH25TFS, PTH27SBU, PTH27RLSS, PTH25TFQ, and PTH21TFB, manufactured from June 25, 2007, through March 23, 2016. When the trailer hits a bump, the tire(s) may contact the floor or wheel well and result in tire damage. A damaged tire could deflate and cause a loss of vehicle control, increasing the risk of a crash. Forest River will notify owners, and dealers will install a lift kit to add additional clearance to the vehicles, free of charge. The recall is expected to begin on, or about, May 27, 2016. Owners may contact Forest River customer service at 1-574-642-0607. Forest River's recall number for this campaign is 420-06092015-0050.

16V-179

Starcraft RV (Starcraft) is recalling certain model year 2016 Launch Ultra Lite trailers, model 31BHT, manufactured June 23, 2015, to September 29, 2015. The entry steps may have been installed without using the proper bolts, possibly resulting in the steps loosening or separating from the trailer. Loose steps or steps that drop when weight is applied may cause the user to fall, increasing their risk of injury. Starcraft will notify owners, and dealers will inspect the step installation, correcting the mounting as necessary, free of charge. The recall is expected to begin April 29, 2016. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902292.

16V-180

Nissan North America, Inc. (Nissan) is recalling certain 2016 Frontier V6 vehicles manufactured February 29, 2016, to March 7, 2016. The starter motor wire harness may have been installed in an incorrect position, allowing the starter harness terminal to contact the heat shield and result in an electrical short. An electrical short increases the risk of a fire. Nissan will notify owners, and dealers will inspect and reposition the starter wire harness, as necessary, free of charge. The recall is expected to begin April 2016. Owners may contact Nissan customer service at 1-800-647-7261.

16V-181

Ford Motor Company (Ford) is recalling certain model year 2015-2016 F-650 and F-750 trucks manufactured January 28, 2015, to November 30, 2015. The clip that connects the hand operated parking brake actuator cable to the intermediate parking brake cable may fail. If the parking brake cable connector clip fails, the vehicle may unexpectedly roll, increasing the risk of a crash. Ford will notify owners, and dealers will replace the parking brake cable connector clip, free of charge. The recall is expected to begin May 16, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S15.

16V-182

Ford Motor Company (Ford) is recalling certain model year 2015-2016 Lincoln MKC vehicles manufactured November 25, 2013, to January 25, 2016, and 2016 Ford Explorer vehicles manufactured October 20, 2014, to January 28, 2016. The affected vehicles are equipped with 2.3L GTDI engines and engine block heaters.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2016**

Published April 19, 2016

These engine block heaters have elements that may overheat while plugged in. Overheating of the engine block increase the risk of a fire. Ford will notify owners, and dealers will replace the engine block heater, free of charge. Dealers will also inspect and replace the electrical cord, as necessary. The recall is expected to begin May 16, 2016. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 16S14. Note: Owners should not use the engine block heater until the vehicle has been remedied.

16V-183